

Installation and Operating Instructions

rev. 01/12/16

#### Overview

The BA/♦(H200-TS, H300-TS) is a humidity transmitter which comes in 2% or 3% accuracies and an optional temperature sensor. The temperature sensor can be either a Thermistor or RTD. It can be ordered for either Duct or Outside Air applications with a BAPI-Box (BB) or BAPI-Box 2 (BB2) Enclosure. The transmitter can be wired for either a 0 to 5VDC output or a loop powered 4 to 20mA output and includes a terminal strip for easy field termination.

## **Duct Unit Mounting**

Mount at least 3 duct diameters from humidifiers in the center of the duct wall. Drill a 1 inch hole for the probe in the duct and use two number 8 sheet metal screws to attach the sensor to the duct. Center the probe in its mounting hole. Be sure that the foam seals the hole, do not over tighten the screws.

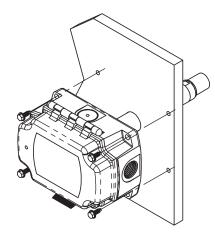


Fig. 1: Duct Humidity in a BAPI-Box (BB) Enclosure

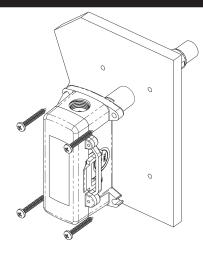


Fig. 2: Duct Humidity in a BAPI-Box 2 (BB2) Enclosure

### **Outside Air Mounting**

Mount in a permanently shaded area away from windows and doors. Do not mount in direct sunlight. Mount with the sensor probe pointed down. Drill a hole large enough for your sensor cable through your mounting surface. Mount the unit to the surface with the wiring knock out centered over the wiring hole. Pull the wiring into the unit and terminate using sealant filled connectors.

Best practice is to seal the wiring hole with caulk after the wiring is installed. Be sure that the foam on the back of the unit makes a good weather tight seal.

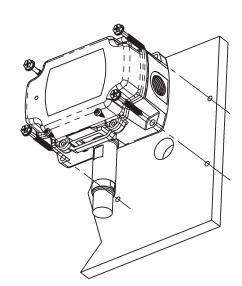


Fig. 3: Outside Humidity in a BAPI-Box (BB) Enclosure

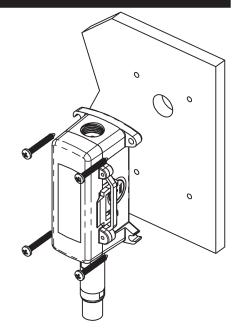


Fig. 4: Outside Humidity in a BAPI-Box 2 (BB2) Enclosure



Installation and Operating Instructions

rev. 01/12/16

## Wiring and Termination

BAPI recommends using twisted pair of at least 22AWG and sealant filled connectors for all wire connections. Larger gauge wire may be required for long runs. All wiring must comply with the National Electric Code (NEC) and local codes. Do NOT run this device's wiring in the same conduit as AC power wiring. BAPI's tests show fluctuating and inaccurate signals are possible when AC power wiring is in the same conduit as the signal lines. If you are experiencing any of these difficulties, please contact your BAPI representative.




BAPI recommends wiring the product with power disconnected. Proper supply voltage, polarity and wiring connections are important to a successful installation. Not observing these recommendations may damage the product and void the warranty.

Table 1: Humidity Transmitter with 4 to 20mA Output			
Label	Purpose	Note	
V, SIG	Not Used	Not Used (Cap Wires)	
+, PWR	Power	10 to 35VDC	
-, SIG	Humidity Output	4 to 20 mA, To Analog Input of Controller	

Table 2: Humidity Transmitter with 0 to 5VDC Output				
Label	Purpose Note			
V, SIG	Humidity Output	0 to 5VDC, To Analog Input of Controller		
+, PWR	Power	10 to 35VDC or 12 to 27VAC		
-, SIG	GND (Common)	Ground for Power and Humidity Output		

Table 3: Temperature Sensor Lead Wire Colors					
Thermistors		Platinum RTDs - 2 Wire			
1.8ΚΩ	Orange/Red	100Ω	Red/Red		
2.2ΚΩ	Brown/White	1ΚΩ	Orange/Orange		
3ΚΩ	Yellow/Black	Nickel RTD			
3.25ΚΩ	Brown/Green	1ΚΩ	Green/Green		
3.3ΚΩ	Yellow/Brown	Silicon RTD			
10K-2Ω	Yellow/Yellow	2ΚΩ	Brown/Blue		
10K-3Ω	Yellow/Red	Platinum RTDs - 3 Wire			
10K-3(11K)Ω	Yellow/Blue	100Ω	Red/Red/Black*		
20ΚΩ	White/White	1ΚΩ	Orange/Orange/Black*		
47ΚΩ	Yellow/Orange	*In the 3-Wire RTD sensors listed above,			
50ΚΩ	White/Blue	the two wires of similar color are			
100ΚΩ	Yellow/White	connected together.			

Additional sensors are available so your sensor may not be listed on this table.

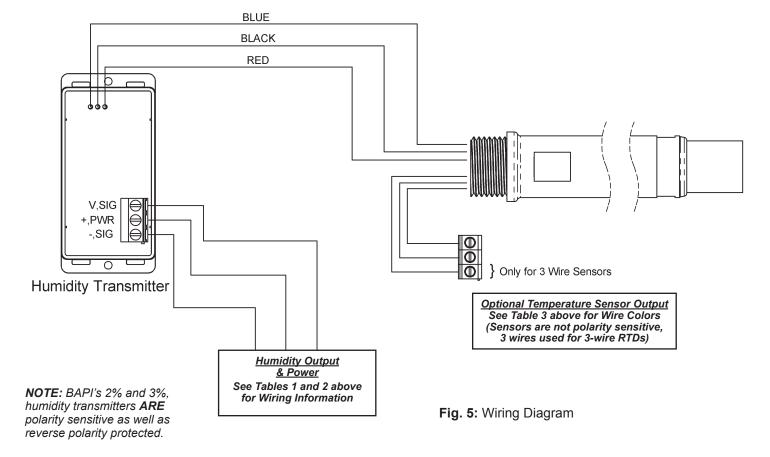



Installation and Operating Instructions

rev. 01/12/16

### Specifications

Power:

10 to 35 VDC For 0 to 5 VDC or 4 to 20 mA Humidity Outputs

12 to 27 VAC For 0 to 5 VDC Humidity Output

**Power Consumption:** 

22 mA max. DC For 0 to 5 VDC or 4 to 20 mA Humidity Outputs

0.53 VA max. AC For 0 to 5 VDC Humidity Output

Sensor: Factory corrected @17 RH points (10 to 90% RH)

Humidity Capacitive Polymer

RH Accuracy ±2% @ 73°F (23°C) from 10 to 90%

Drift 0.5% per year

Response time < 5 seconds in moving air

RH Linearity Negligible, factory corrected linier from 10 to 90%

RH Hysteresis Factory corrected to <1% Opt. Temp. Passive RTD or Thermistor

Filter: 80 micron sintered stainless steel filter

Calibrated Accuracy: Calibration @17 RH points, (10% to 90%)

RH 2% 2% from 10 to 90% @ 73°F (23°C), Non-condensing RH 3% 3% from 10 to 95% @ 73°F (23°C), Non-condensing

Thermistor ±0.36°F (0.2°C) from 32 to 158°F (0 to 70°C) - High accuracy units are available

RTD ±0.55°F (0.31°C) @ 32°F (0°C) - High accuracy units are available

Output: Selectable via wiring detail

Humidity 0 to 5VDC or 4 to 20mA at 0 to 100% RH

Opt. Temp. Resistance RTD or Thermistor

**Humidity Output Impedance:** 

Current 700Ω@ 24VDC, Voltage drop is 10VDC

(Supply Voltage DC – Transmitter voltage drop 10VDC) / 0.02 Amps = Max load Impedance

Voltage  $10K\Omega$ 

**Probe Length:** 

Duct 5.3" (13.5cm) Duct Insertion, 1" diameter Outside Air 2.4" (6.1cm) Below Enclosure, 1" diameter

**Dimensions:** W x H x D

BAPI-Box (BB) 4.15" x 5" x 2.5", (105.4 x 127 x 63.5mm) BAPI-Box 2 (BB2) 4.9" x 2.8" x 2.35", (124.8 x 71.6 x 59.7mm)

Termination:

Terminals 14 to 26 AWG

**Enclosure Material:** 

BAPI-Boxes (BB, BB2) Polycarbonate, UV resistant

**Enclosures Ratings:** 

BAPI-Boxes (BB, BB2) NEMA-4, IP66, UL94V-0

Environmental Operation Range: -40° to 158°F (-40° to 70°C) • 0% to 100% RH

Approvals: RoHS



Installation and Operating Instructions

rev. 01/12/16

#### Filter Care

A sintered filter protects the humidity sensor from various airborne particles and may need periodic cleaning. To do this, gently unscrew the filter from the probe. Rinse the filter in warm soapy water and rinse until clean. A nylon brush may be used if necessary. Gently replace the filter by screwing it back into the probe. The filter should screw all the way into the probe. Hand tighten only. If a replacement filter is needed, call BAPI.

**BA/HDOFS3** 

Stainless Steel Sintered Filter Replacement for Outside Air Units

### Humidity Diagnostics

### **Possible Problems:**

Unit will not operate

### **Possible Solutions:**

 Check for proper supply power. (See page 2 for wiring diagram and power specifications)

Humidity output is at its maximum value of 5V or 20mA

- Make sure the humidity sensor is wired properly.

Humidity output is at its minimum value of 0V or 4mA

- Make sure the humidity sensor is wired properly.

Humidity reading in controller's software appears to be off by more than the specified accuracy

- Check all software parameters
- Determine if the sensor is exposed to an external air source different from the intended measured environment or reference device.
- Check the Humidity transmitter output against a calibrated reference such as a 2% accurate hygrometer. Measure the humidity at the sensor's location using the reference meter, then calculate the humidity transmitter output using the humidity formula at left. Compare the calculated output to the actual humidity transmitter output (see the wiring diagram on page 2 for the humidity transmitter output wire colors). If the calculated output differs from the humidity transmitter output by more than 4% to 5%, contact BAPI technical support.

Output	Humidity Formula	
4 to 20mA	%RH =(mA-4)/0.16	
0 to 5VDC	%RH = V/0.05	

### Temperature Diagnostics

### **Possible Problems:**

Controller reports Incorrect temperature

### **Possible Solutions:**

- Confirm the input is set up correctly in the controller's software
- Verify that the sensor wires are not physically shorted or open
- Check wiring for proper termination
- Measure the temperature at the temperature sensor's location using an accurate temperature standard. Disconnect the temperature sensor wires and measure the temperature sensor's resistance with an ohmmeter. Compare the temperature sensor's resistance to the appropriate temperature sensor table on the BAPI website. If the measured resistance is different from the temperature table by more than 5%, call BAPI technical support. BAPI's web site is found at www.bapihvac.com; click on the button labeled "Sensor Specs" and then click on the type of sensor you have.