


Installation & Operating Instructions

rev. 07/22/20

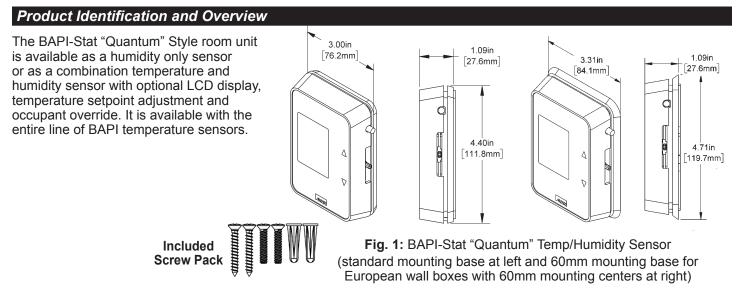

### Mounting

#### JUNCTION BOX

- 1. Pull the wire through the wall and out of the junction box, leaving about 6" free. Pull the wire through the hole in the base plate. Secure the base to the box using the #6-32x1/2" mounting screws provided.
- 3. Terminate the unit according to the guidelines in the Termination section.
- 4. Attach Cover by latching it to the top of the base, rotating the cover down and snapping it into place.
- 5. Secure the cover by backing out the lock-down screws using a 1/16" Allen wrench until they are flush with the bottom of the cover.

#### **DRYWALL MOUNTING**

- 1. Place the base plate against the wall where you want to mount the sensor. Mark out the two mounting holes and the area where the wires will come through the wall.
- 2. Drill two 3/16" holes in the center of each marked mounting hole. Insert a drywall anchor into each hole.
- 3. Drill one 1/2" hole in the middle of the marked wiring area. Pull the wire through the wall and out the 1/2" hole, leaving about 6" free. Pull the wire through the hole in the base plate.
- Secure the base to the drywall anchors using the #6 x 1 inch mounting screws provided.
- 5. Terminate the unit according to the guidelines in the **Termination** section.
- Attach cover by latching it to the top of the base, rotating the cover down and snapping it into place. Secure the cover by backing out the lock-down screws using a 1/16" Allen wrench until they are flush with the bottom of the cover.

**NOTE:** The mixing of room air and air from within the wall cavity can lead to erroneous readings, condensation and failure of the sensor. To prevent this, plug the conduit hole in the junction box with insulation.

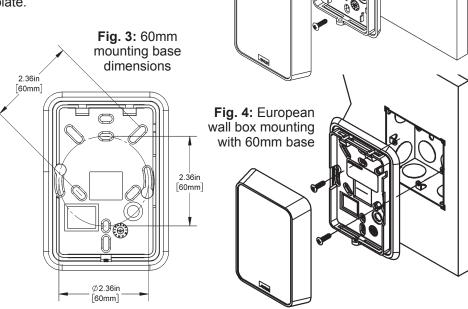


Fig. 2: J-Box

mounting with

standard base



Installation & Operating Instructions

rev. 07/22/20

Terminations

**STOP** 

BAPI recommends using twisted pair of at least 22 AWG. Larger gauge wire may be required for long runs. All wiring must comply with the National Electric Code (NEC) and local codes. Do NOT run this device's wiring in the same conduit as AC power wiring of NEC class 1, NEC class 2, NEC class 3 or with wiring used to supply highly inductive loads such as motors, contactors and relays. BAPI's tests show that fluctuating and inaccurate signal levels are possible when AC power wiring is present in the same conduit as the signal lines.

BAPI recommends wiring the product with power disconnected. Proper supply voltage, polarity, and wiring connections are important to a successful installation. Not observing these recommendations may damage the product and will void the warranty.

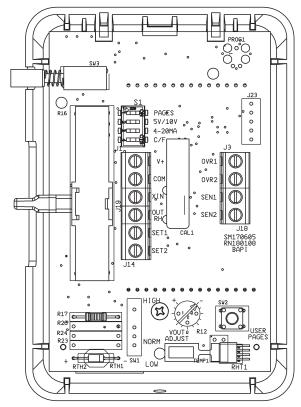


Fig 5: Circuit Board

# 0 to 5 VDC and 0 to 10 VDC Output Unit Termination

<u>lerminal</u>	Function
V+	.Power, see specifications section for details.
COM	. To controller power supply ground.
XIN	Allows remote control of the LCD indicator for occupancy, and is activated by logic LOW or power supply ground at this terminal.
OUT RH	.Voltage Humidity Signal [to analog input of controller].
SET1 & SET2	. Temperature Setpoint Output. If unit is a Common Ground model, see Note below.
OVR1 & OVR2	. Override Output – Dry Contact Switch. If unit is a Common Ground model, see Note below.
SEN1 & SEN2	. Temperature Sensor Output – Resistance. If unit is a Common Ground model, see Note below.

### 4 to 20 mA Output Unit Termination

<b>Terminal</b>	<b>Function</b>
V+	.Power, see specifications section for details.
COM	.4 to 20 mA Humidity Signal [to analog input of controller].
XIN	Allows remote control of the LCD indicator for occupancy, and is activated by logic LOW or power supply ground at this terminal.
OUT RH	.Not Used.
SET1 & SET2	Temperature Setpoint Output.

# If unit is a Common Ground model, see Note below.

- OVR1 & OVR2...Override Output Dry Contact Switch. If unit is a Common Ground model, see Note below.
- SEN1 & SEN2 ... Temperature Sensor Output Resistance.

If unit is a Common Ground model, see Note below.

#### Notes:

#### On Common Ground (default) Models:

**Resistive Setpoint:** Terminals "OVR2", "SEN2", and "SET2" are connected together internally but they are not connected to Ground "COM". If you intend to use "COM" as common, then a jumper must be added from terminal "COM" to "SEN2". This is only allowed on Humidity Voltage Output Models. Do not install this jumper on Humidity 4 to 20 mA Output models.

**Voltage Setpoint:** Terminals "OVR2", "SEN2", and "SET2" are connected to Ground "COM". This is only allowed on Humidity Voltage Output models. Do not adjust DIP Switch S1 to Humidity 4 to 20mA Output as the output will be shared with OVR2, SEN2, and SET2.

#### **On Differential Ground Models:**

All terminals are independent unless unit is configured for Voltage Setpoint (in that case SET2 is connected to COM).

Specifications subject to change without notice.



Installation & Operating Instructions

rev. 07/22/20

#### **Optional Test Balance Switch (SW2)**

The test and balance switch is used by the balancer to equalize the flow of air or water. It can also be used to verify sensor termination in a point-to-point checkout of the control system. The "NORM" position allows the real sensor to be monitored. The "HI" position forces the output to a very hot reading and the "LOW" position forces the output to a very cold output (See Table 1).

#### Optional Test and Balance Switch (SW2)

#### Table 1: Test and Balance Resistance Values

Low: Will set sensor value low
Norm: Sensor will operate normally
High: Will set sensor value High

Sensor Type	Low Temp	High Temp	
1000 Ω RTD	1.02K Ω (41.2°F)	1.15K Ω (101.5°F)	
3000 $\Omega$ Thermistor	7.87K Ω (39.8°F)	1.50K Ω (106.8°F)	
10K-2 Thermistor	30.1K Ω (34.9°F)	4.75K Ω (109.1°F)	
10K-3 Thermistor	26.7K Ω (35.9°F)	5.11K Ω (108.4°F)	
10K-3(11K) Thermistor	7.32K Ω (43.7°F)	3.65K Ω (105.2°F)	

#### **Optional Communications Jack Wiring**

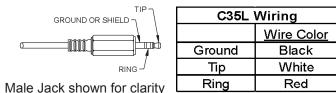


Fig 6: C35L Communications Jack

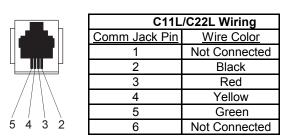


Fig 7: C11L/C22L Communications Jack

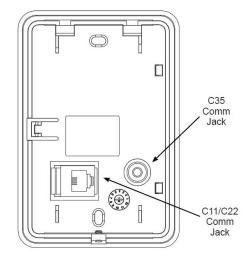


Fig 8: Communications Jack Locations

### Humidity Output and °C or °F Display DIP Switch (S1)

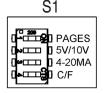


Fig 9: Humidity Output DIP Switches

NOTE: When looking at DIP Switch S1, ON is to the right, OFF is to the left.

PAGES: Factory set to the OFF position. To enter into Program Mode, switch to ON.

**5V/10V:** Sets the humidity output. Factory set per the configuration ordered. For 0 to 5V output, switch is OFF. For 0 to 10V output, switch is ON.

**4-20MA:** Sets the humidity output. Factory set per the configuration ordered. For 4 to 20mA output, Switch is ON. For 0 to 5V and 0 to 10V outputs, Switch is OFF. Do not set to 4 to 20mA output if temperature setpoint is a voltage output.

**C/F:** Sets the temperature display in °C (Celsius) or °F (Fahrenheit). Factory set per the configuration ordered. For °C, switch is OFF. For °F, switch is ON. When unit does not have a display, switch is shipped in ON position.



Installation & Operating Instructions

rev. 07/22/20

#### Humidity Offset Potentiometer (R12) for units without display



Potentiometer R12 can be used to adjust the humidity output by  $\pm 5\%$  for units without display. A high accuracy humidity reference is recommended. Note: For units with display, the offset is set via the programming pages described in the Optional Technician Adjustments section on page 5.

Fig 10: R12 %RH Adjustment Potentiometer

#### **User Operation**

The display indicates temperature in degrees Fahrenheit or Celsius, relative humidity in %RH, temperature setpoint in degrees Fahrenheit or Celsius. Temperatures and relative humidity can be displayed in a rotating manner, see the Optional Technician Adjustments section. The Human Icon icon indicates that the override button has been pushed.

#### **Temperature:**

Displayed in Fahrenheit or Celsius. Can rotate between major and minor of display with relative humidity.

#### **Relative Humidity:**

Displayed in %RH. Can rotate between major and minor of display with temperature.

#### Temperature Setpoint Slidepot:

Moving the slidepot enough to change the setpoint will display the setpoint in the major of the display if equipped with display. The setpoint temperature display will flash the digits indicating that setpoint is being changed.

#### **Override Button:**

When the override button is pressed on display units, the Human Icon Icon will display. A dry resistance of less than 15 ohms appears across the override output. Latching the Icon to show that the system is in override requires that a dry contact on your controller be used to connect terminal XIN to ground.

Note: The unit must receive a confirmation (ground) signal on the "XIN" terminal for the Human Icon to remain visible on the screen. Pressing the Override button will light the Human Icon icon; however, if no confirmation signal is received, then the Human Icon will go blank (disappear) after 5 seconds.

Upon receiving a first confirmation (ground) signal on the "XIN" terminal, the Human Icon will show occupied (Solid). The Human Icon will then show unoccupied (Hollow) whenever the confirmation signal is removed and occupied when the signal is returned. The only way to blank the Human Icon from the display at this point is to cycle power

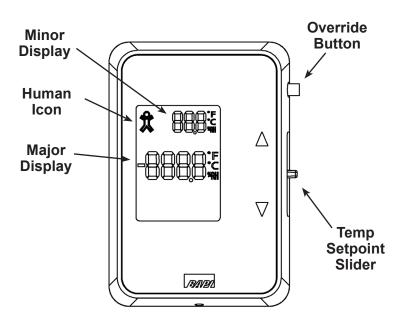


Fig 11: BAPI-Stat "Quantum" Humidity or Temp/Humidity Unit Indicators (Shown with all optional indicators)

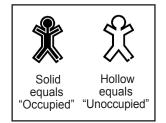


Fig. 12: Human Icon

Specifications subject to change without notice.

Installation & Operating Instructions

41147\_ins\_quantum\_hum

#### **Optional Technician Adjustments**

#### Adjustments for Units with a Display

The optional technician adjustments allows a technician to set temperature and humidity offsets, display settings and output parameters. There are nine pages with programmable parameters.

Entering Program Mode to Adjust Parameters (see Figs. 13-15 for adjustment tools)
1. Power unit and set DIP Switch S1 #1 (PAGES) to ON (right). The LCD will show a page number (P1-P9) based on the location of the Slide Potentiometer R16. P1-P9 will flash to

- indicate that display parameter can be adjusted.
- 2. Slide Potentiometer R16 is used to scroll up and down through pages and adjusting the page parameters.

NOTE: For units with Temperature Setpoint, the Slide Potentiometer will extend outside the enclosure. For units without Temperature Setpoint, the Slide Potentiometer will not be extended outside the enclosure.

- 3. Push Switch SW2 as "Enter" to switch between pages and adjusting the page parameter.
- 4. After a page parameter has been adjusted, push Switch SW2 to confirm the change.
- 5. To exit Program Mode, Set DIP Switch #1 (PAGES) to OFF (left).

Programming Pages					
Parameter	Page		Adjustment		
Temperature Offset	P1	±5° in 0.1° increments (Temp offset only adjusts display)			
Humidity Offset	P2	±5%RH in 0.1%RH increments (Humidity offset adjusts the display and outpu			
	Р3	Item	Display Action		
Temperature Display		0	Display in whole digits		
Temperature Display		1	Display in 0.5° increments, °F and °C		
		2	Display in 0.1° increments, °F and °C		
	P4	Item	Display Action		
Humidity Display		0	Display in whole digits		
		1	Display in 0.5%RH increments		
		2	Display in 0.1%RH increments		
Temperature Setpoint Display Low	P5	Adjust the Low Temperature of the setpoint range			
Temperature Setpoint Display High	P6	Adjust the High Temperature of the setpoint range			
Humidity Output Low	P7	Adjust the Low Humidity output			
Humidity Output High	P8	Adjust the High Humidity output			
	Р9	Item	Display Action		
		0	Temperature and Humidity rotate between major and minor, Setpoint		
			when active		
Display Options		1	Temperature and Humidity rotate between major and minor		
		2	Temperature in major, Humidity in minor		
		3	Humidity in major, Temperature in minor		
		4	Temperature in Major, minor is off		
		5	Humidity in Major, minor is off		



#### Power:

12 to 35 VDC for 4 to 20 mA or 0 to 5 VDC Output 15 to 35 VDC for 0 to 10 VDC Output 15 to 28 VAC for 0 to 5 VDC or 0 to 10 VDC Output (AC Power requires a separate pair of shielded wires)

#### **Power Consumption:**

20 mA max. for 4 to 20 mA Output 4 mA max. for 0 to 5 VDC and 0 to 10 VDC Output 0.1 VA max. for 0 to 5 VDC and 0 to 10 VDC Output

Wiring: 2 to 5 pair of 16 to 22 AWG

Terminals: Cage clamp, 16 to 22 AWG

Material & Rating: ABS Plastic, UL 94, V-0

#### Sensing Elements:

Temperature - Thermistor or RTD Humidity - Capacitive Polymer ±2%RH @ 25°C (77°F), 20 to 80%RH

**Field Calibration:** Potentiometer (R12), ±5% in 0.1% increments (Units are factory calibrated)

**Mounting:** Standard 2"x4" junction box, European junction box or drywall mount (screws provided)

**Environmental Operation Range:** 

Temperature: 32 to 122 °F (0 to 50 °C) Humidity: 0 to 95%, non-condensing

Agency: RoHS

Specifications subject to change without notice.

S1 Southern 10 5V/10V Southern 10 4-20MA Southern 20 4-20MA Southern 20 4-20MA

rev. 07/22/20

Fig 13: DIP Switch S1

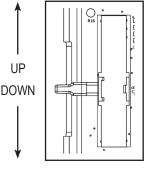


Fig 14: R16 Slide Potentiometer (for making program adjustments)



Fig 15: SW2 Calibration Switch





Installation & Operating Instructions

rev. 07/22/20

. VSpan

### Diagnostics

<b>Possible Problems:</b>
---------------------------

#### General troubleshooting

#### **Possible Solutions:**

- Determine that the input is set up correctly in the controller and BAS.
- Check wiring at the sensor and controller for proper connections.
- Label the wire terminals at the sensor end and the controller end. Disconnect the interconnecting wires from the controller and the sensor. With the interconnecting wires separated at both ends measure the resistance from wire-to-wire with a multimeter. The meter should read greater than 10 Meg-ohms, open or OL depending on the meter you have. Short the interconnecting wires together at one end. Go to the other end and measure the resistance from wire-to-wire with a multimeter. The meter should read less than 10 ohms (22 gauge or larger, 250 feet or less). If either test fails, replace the wire.
- Determine if the sensor is exposed to an external source different from the room environment (conduit draft). Plug the conduit or fill the handy box as necessary. DO NOT use silicon caulk.

#### Incorrect Humidity

- Check power supply/controller voltage supply
  - Disconnect sensor and check power wires for proper voltage (see specifications page)
  - Check all software parameters
  - **Voltage Humidity Equation** • Check the sensor humidity output against a reference. Measure the humidity at the sensor's location using an RH = RHLow + (V-VLow) x (RHSpan) accurate standard. Disconnect the humidity channel wires and measure the RH = %RH at sensor humidity signal with RHLow = Low %RH of Span a multi-meter and 4-20mA Humidity Equation RHHigh = High %RH of Span compare to the RHSpan = RHHigh - RHLow RH = RHLow + (A - 4) x (RHSpan)reference, using the = Low transmitter voltage 16 VLow equations at right for usually=(0v) RH = %RH at sensor the reference. If the = High transmitter voltage VHigh RHLow = Low %RH of Span output and reference usually=(5 or 10 v)RHHigh = High %RH of Span differ by more VSpan = VHigh - VLow RHSpan = RHHigh - RHLow = Signal reading in volts than 5%, call BAPI = Signal reading in mA V Α technical support.
- Incorrect Temperature
  - Determine that the temperature sensor's wires are connected to the correct controller input terminals, and check the wires at the sensor and controller for proper connections.
    - Measure the physical temperature at the sensor's location using an accurate temperature standard. Disconnect the temperature sensor's wires (Terminals SEN1 & SEN2) and measure the temperature sensor's resistance across the output pins. Put the ohmmeter black lead on SEN2 and the red lead on SEN1. Compare the temperature sensor's resistance to the appropriate Sensor Resistance Table on the BAPI website (See below). If the measured resistance varies from the table by more than 5%, call BAPI technical support.

#### How to Find The Temperature Sensor Resistance Table

Find BAPI's web site at www.bapihvac.com; click on "Resource Library" and "Sensor Specs" and then click on the sensor type you have.